

Date: Monday, 11/12/2007 1:11:57 PM
 User: Kim Johnston

Process Sheet

49

Customer : CU-DAR001 Dart Helicopters Services Drawing Name : SKID TUBE ASSEMBLY
 Job Number : 35643
 Estimate Number : 10023
 P.O. Number :
 This Issue : 11/12/2007 S.O. No. :
 Prsht Rev. : NC Part Number : D205634041
 First Issue : / / Type : LANDING GEAR Drawing Number : D2580 REV D
 Previous Run : 35642 Material :
 Due Date : 12/5/2007 Qty: 1 Um: Each
 Written By :
 Checked & Approved By : KS 07.11.12
 Comment : Est Rev: N 02.08.28 FP was QC5 in Step 27; Added QC5 to Step 30 KJ
 Est Rev. O 06.02.28 Added paperwork EC
 Est Rev: P 07-07-09 SS Wearplates & Gaskets JLM

Additional Product

Job Number:



Seq. #: Machine Or Operation: Description :

1.0

DC

DOCUMENT CONTROL



Comment: DOCUMENT CONTROL

Photocopy D205-634 bluefile & type labels per PPP D205-634 CHG002

KS 07.11.13

2.0

D25001190

Ext'n -1" Beam Tube 4"



Comment: Qty.: 1.0400 Each(s)/Unit Total : 1.0400 Each(s)

Pick:

Qty Part Number

Description

Batch

1 D2500-1-190

Skid Tube Extrusion

B 34729

K 7-11-12

3.0

D2596

205 Web



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

1 D2596

205 Web

33836

SL 7-11-12

4.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1- Inspect mat'l D2500-1-190 for damage

2-Cut D2500-1-190 per Dwg D2580 if necessary Debur ends

3-Acid etch and Alodine tube per QSI 005 4.1

K 7-11-12
SL 7-11-12

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Monday, 11/12/2007 1:11:57 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 35643

Part Number: D205634041

Job Number:



Seq. #:

Machine Or Operation:

Description :

5.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

DP 2-11-13

6.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Drill pilot holes using drill jig DT 8149(Do not use cutting fluid)

2-Open holes to 0.500" as per Dwg D2580without cutting fluid

3-Countersink holes as per Dwg D2580without cutting fluid

4-Deburr and blow out all chips from inside of tube

5-Bond web in place per QSI 015. Allow 12 Hrs. cure time before cutting

Pick:

Qty Part Number Description Batch

A/R Sikaflex-291 105488

Sikaflex expire date: 8-7-1

Start Time: 10:15 Date: 7-11-13

Fin Time: 4:15 Date: 7-11-14

SL 7-11-13

7.0

BENDING

BENDING MACHINE



Comment: BENDING MACHINE

1-Bend as per program D2580.C on CNC Bender and Folio FT009

2-Cut tubes as per Dwg. D2580

DP 8-1-22

EC/JR 7-11-14

ATC

8.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1



 
 

1-Deburr ends

2-Prepare tube for welding, remove alodine as required.

3 BE 08/01/28

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes ☐ No ☒ DQA: ☒ Date: 08/02/20
 QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			
08/02/20	1	skid tube is over bent by 0.625 off out of tol. per drawing EC take Bender. first run.		tube is accurate				

NOTE: Date & initial all entries

Date: Monday, 11/12/2007 1:11:57 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 35643

Part Number: D205634041

Job Number:



Seq. #:

Machine Or Operation:

Description :

9.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

10.0

D25763

Step (Machining Detail)



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty

Part Number

Description

Batch

1

D2576-3

Step

B33321-1

BE 08/01/31

11.0

D2579

Crossbolt Spacer



Comment: Qty.: 20.0000 Each(s)/Unit Total : 20.0000 Each(s)

Pick:

Qty

Part Number

Description

Batch

20

D2579

Spacers

B36326

BE 08/01/29

12.0

LARGE FAB 1

LARGE FABRICATION RESOURCE 1



Comment: LARGE FABRICATION RESOURCE 1

2-Weld step D2576 as per Dwg. D2580 and QSI 004

A/R

Aluminum Rod

m 106390

BE 08/01/31

3-Weld crossbolt spacers D2579 as per Dwg. D2580 and QSI 004.

For D2579 spacers, weld one side, pass 3/8" drill, weld other side, pass 3/8" drill

A/R

Aluminum Rod

m 106390

BE 08/01/29

4-Grind welds as per Dwg D2580 Grind flush ridge made from bending

a.m 08.01.29

5-Drill holes for wearplates using DT 8217 & DT8937 Open holes to 19/64", adjust stopper not to hit web. Debur

a.m 08.01.29

6-Counterbore crossbolt spacers to 7/16" ID x 1.0" deep as per Dwg D2580. Debur holes

a.m 08.01.29

7-Drill pilot holes for aft cap using DT 8215 Open holes to 0.208". Debur

a.m 08.01.29

8-Drill pilot holes for Tow ring using DT8091, open to .640" and Debur

a.m 08.01.29

W/O:		WORK ORDER CHANGES							
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)							
DATE	STEP	Description of NC Section A	Corrective Action			Verification Section C	Approval Chief Eng	Approval QC Inspector	
			Initial Chief Eng	Action Description Chief Eng	Sign & Date				

NOTE: Date & initial all entries

Date: Monday, 11/12/2007 1:11:57 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 35643

Part Number: D205634041

Job Number:



Seq. #:

Machine Or Operation:

Description :

13.0

QC9

VISUAL WELDING INSPECTION



Comment: VISUAL WELDING INSPECTION

PD 08-02-19

(1)

14.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

S 08/02/19 (M)

15.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Pressure wash as per QSI 005

FL 08/02/20 (1)

16.0

POWDER COATING

POWDER COATING



Comment: POWDER COATING

Powder Coat White Gloss (Ref: 4.3.5.1) as per QSI 005 4.3

M107005

08-02-20

(x1)

17.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

FL 08/02/20 (1)

18.0

D2855

Cap



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Cap

Batch:

B35663

FL

19.0

AN35A

Bolt



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Bolt

Batch:

m100188

FL

20.0

AN960JD10L

Washer



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Washer

Batch:

m104885

FL 08/02/20 (1)

W/O:		WORK ORDER CHANGES							
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Monday, 11/12/2007 1:11:57 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 35643

Part Number: D205634041

Job Number:



Seq. #:

Machine Or Operation:

Description:

21.0

ALS71032130

Insert



ALS41032130 m 2008/2/25



Comment: Qty.: 50.0000 Each(s)/Unit Total: 50.0000 Each(s)

Insert

Batch: m 105730

FL

22.0

AN3C4A

BOLT



Comment: Qty.: 50.0000 Each(s)/Unit Total: 50.0000 Each(s)

BOLT

Batch: m 107008

FL

23.0

AN960C10L

washer



Comment: Qty.: 50.0000 Each(s)/Unit Total: 50.0000 Each(s)

washer

Batch: m 107008

FL

24.0

D356613

GASKET



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

GASKET

Batch: B32744

FL

25.0

D35665

GASKET



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

GASKET

Batch: B36526

FL

26.0

D35661

GASKET



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

GASKET

Batch: B36934

FL

27.0

D356413

WEARSHOE



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

WEARSHOE

Batch: B36337

FL 08/02/20 ①

W/O:		WORK ORDER CHANGES							
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)							
DATE	STEP	Description of NC Section A	Corrective Action			Verification Section C	Approval Chief Eng	Approval QC Inspector	
			Initial Chief Eng	Action Description Chief Eng	Sign & Date				

NOTE: Date & initial all entries

Date: Monday, 11/12/2007 1:11:57 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 35643

Part Number: D205634041

Job Number:



Seq. #:

Machine Or Operation:

Description :

28.0

D356411

WEARSHOE



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARSHOE

Batch: B34805

FL

29.0

D35649

WEARSHOE



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARSHOE

Batch: B36637

FL

30.0

D35645

WEARSHOE



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARSHOE

Batch: B36338

FL

31.0

D25943

O-Ring



Comment: Qty.: 16.0000 Each(s)/Unit Total : 16.0000 Each(s)

O-Ring

Batch: B27168

FL

32.0

D25941

Plug



Comment: Qty.: 16.0000 Each(s)/Unit Total : 16.0000 Each(s)

Plug

Batch: B25941 B36327

FL

33.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

1-Install inserts & wearplates & Gaskets as per Dwg. D2580. Use a drop of Sikaflex on insert holes before installing wearplates

A/R Sikaflex-291

Sikaflex expire date: 08-07

2-Coat D2594-3 O' rings with Petroleum Jelly and install on D2594-1 plugs as per Dwg D2580

3-Inspect for foreign object per QSI 024

FL 08/02/20 ①

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Monday, 11/12/2007 1:11:57 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 35643

Part Number: D205634041

Job Number:



Seq. #:

Machine Or Operation:

Description :

4-Install 2855 Aft Cap as per Dwg D2580 and seal Fwd Step & Aft Cap with Sikaflex. Clean excess adhesive

A/R Sikaflex-291

Sikaflex expire date: 08-07

5-Wing Walk as per Dwg D2580 and QSI 005 4.4

Batch: m 106899

FL 08/02/20 (1)

FL 08/02/20 (1)

34.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: Inspect Aft Cap, Fwd Step and Wing Walk of work to Current Step Inspect for Foreign objects per QSI 024

35.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and pack for shipping as per PPP D205-634-041

Location: 1

PPP Rev: 1

8/2/26 50 (1)

36.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

2008/02/26 (1)

Job Completion



m 2008/2/26 (1)

35643

W/O:		WORK ORDER CHANGES							
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)							
DATE	STEP	Description of NC Section A	Corrective Action		Section B		Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng		Sign & Date			

NOTE: Date & initial all entries

DART

DESIGN #	DRAWN BY RH	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
CHECKED #	APPROVED #	DRAWING NO. D2580	REV. D SHEET 1 OF 3
DATE 07.02.27		TITLE 205 SKIDTUBE ASSEMBLY	SCALE NTS
A	96.09.16	NEW ISSUE	
B	96.12.02	AS MANUFACTURED	
C	98.08.26	REDRAWN, INCLUDED DEO 9094/9097	
D	07.02.27	CHANGE TO SS WEARPLATES AND GASKETS, INCLUDE DEO 9124/9183	

RELEASED
07-06-28 #

QTY -041	QTY -045	Part Number	Description
X		D2580-041	SKIDTUBE ASSEMBLY
	X	D2580-045	SKIDTUBE ASSEMBLY
1	1	D2500-1-190	EXTRUSION
1	1	D2576-3	STEP
20	24	D2579	CROSS BOLT SPACER
16	16	D2594-1	PLUG
16	16	D2594-3	O-RING
1	1	D2596	205 WEB
1	1	D2855	AFT CAP
1	1	D3564-5	WEARSHOE
1	1	D3564-9	WEARSHOE
1	1	D3564-11	WEARSHOE
1	1	D3564-13	WEARSHOE
2	2	D3566-1	GASKET
1	1	D3566-5	GASKET
1	1	D3566-13	GASKET
50	50	ALS7-1032-130 or AKS7-1032-130 or AKS4-1032-130 or AELS-1032-130	INSERT
50	50	AN3C4A	BOLT
2	2	AN3-5A	BOLT
50	50	AN960C10L	WASHER
2	2	AN960JD10L	WASHER

GENERAL NOTES:

- 1) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- 2) ALL DIMENSIONS ARE IN INCHES
- 3) INSERT D2596 WEB TO LOCATION SHOWN OFF AFT END OF SKIDTUBE AND BOND WEB INTO OUTER TUBE WITH NON-STRUCTURAL SIKAFLEX-241 ADHESIVE PER DART QSI 015 BEFORE BENDING. ENSURE HOLES LINE-UP.
- 4) BEND AS A SMOOTH RADIUS STARTING WITH A MAXIMUM CENTERLINE RADIUS OF 60 AND ENDING WITH A MINIMUM RADIUS OF 30. A MAXIMUM REDUCTION OF 0.200 IN DIAMETER IS ALLOWABLE IN THE BENT PORTION OF THE TUBE.
- 5) USE DART DRILL TEMPLATE TD2577-205 TO LOCATE AND DRILL Ø0.297 HOLES FOR WEARSHOE INSERTS. INSTALL ALS7-1032-130 PER SECTION D-D (50 PLACES) AFTER FINISH. INSTALL AN3C4A BOLTS AND AN960C10L WASHERS WITH SIKAFLEX-241/-291.
- 6) WELDING TO BE DONE PER DART QSI 004.
- 7) FINISH:
SEE NOTES ON
PAGE 2 FOR D2580-041 AND
PAGE 3 FOR D2580-045
- 8) INSERT D2594-1 PLUG C/W D2594-3 O-RING IN HOLES MARKED 'P' (BOTH SIDES OF TUBE) AFTER FINISH (16 PLACES).

SHOP COPY
RETURN TO
ENGINEERINGUNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER

NO. 35643

Copyright © 1996 by DART AEROSPACE LTD

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

RELEASED
07-06-28-11

Diagram illustrating the underside of the D2576-3 step, showing the locations for grinding flush and the location ridge on the underside of the D2576.

Labels:

- GRIND FLUSH (4 PLACES)
- GRIND FLUSH
- D2576-3 STEP
- LOCATION RIDGE ON UNDERSIDE OF D2576

D2579 SPACER

WEB (REF)

130 (REF)

10 PLACES

AFTER PERFORM

1. CHA
2. INS
3. WEI
4. C'B

AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR Ø0.508 HOLES ONLY:

1. CHAMFER HOLE 0.050 X 45°
2. INSERT D2579 SPACER (20 PLACES)
3. WELD INTO PLACE AND GRIND FLUSH
4. C'BORE D2579 SPACER TO Ø0.437 X 1.00 DEEP

i) FINISH: ACID ETCH, ALODINE PER DART QSI 005 4.1 PRIOR TO INSERTING D2596 WEB.
POWDER COAT ASSEMBLY GLOSS WHITE (REF. 4.3.5.1) PER DART QSI 005 4.3
BLACK ANTI-SKID PAINT AS INDICATED PER DART QSI 005 4.4

37.50
DISTANCE TO AFT END
OF D2596 WEB
3 7
REFER TO DETAIL A
1.750 1.750
#0.508 (TYP.)
(40 PLACES)
REFER TO DETAIL A
8.750
17.375
26.000
34.188
57.313 (REF)
7 EQUAL SPACES
8.188 PITCH
38.0
91.500
190.0
(D2500-1)

WELD AS PER DETAIL B

BLACK ANTI-SKID TO 0.5 ABOVE LOCATION RIDGE

BLACK ANTI-SKID TOP OF STEP TO 0.5 ABOVE BOTTOM EDGE

0.5 | 1.5 | 1.5 | D | P | P | P | P | P | P | P | 1.5 | 1.5 | 1.5

8

REFER TO DETAIL C

D3566-1 | D3566-5 | D3566-1 | D3566-13





D3564-11 | D3564-5 | D3564-9 | D3564-13

AN3C4A BOLT (1)
AN96OC10L WASHER (1)
(50 PLACES)

DESIGN	JJ	DRAWN BY	
--------	----	----------	--

COPYRIGHT © 1986 BY DART AEROSPACE LTD.


THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL
AND IS SUPPLIED ON THE EXPRESS CONDITION
THAT IT IS NOT TO BE USED FOR ANY PURPOSE
OR COPIED OR COMMUNICATED TO ANY OTHER
PERSON WITHOUT WRITTEN PERMISSION FROM
DART AEROSPACE LTD.

DESIGN		DRAWN BY	
CHECKED		APPROVED	
DATE			
07.02.27			


DART DART AEROSPACE LTD.
HAMPSHIRE, ONTARIO, CANADA

DRAWING NO.	REV. D
D2580	SHEET 2 OF 3
TITLE	SCALE
205 SKIDTUBE ASSEMBLY	1:24

DETAIL E
SCALE 5:24

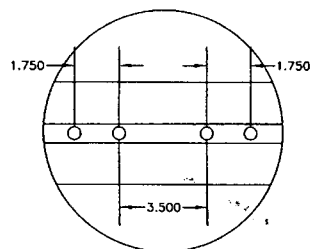


DETAIL F
SCALE 5:24

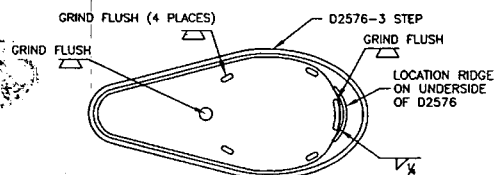


RELEASED
07 Dec 84

DETAIL G
SCALE 5:24

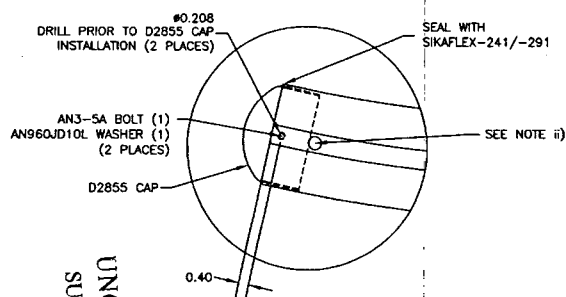


SECTION H-H
SCALE 5:24

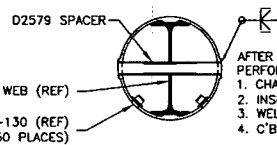


- AFTER DRILLING AND BENDING ASSEMBLY PERFORM THE FOLLOWING FOR #0.508 HOLES ONLY:
1. CHAMFER HOLE 0.050 X 45°
 2. INSERT D2579 SPACER (20 PLACES)
 3. WELD INTO PLACE AND GRIND FLUSH
 4. C'BORE D2579 SPACER TO #0.437 X 1.00 DEEP


D2580-1 DRILLING DETAIL

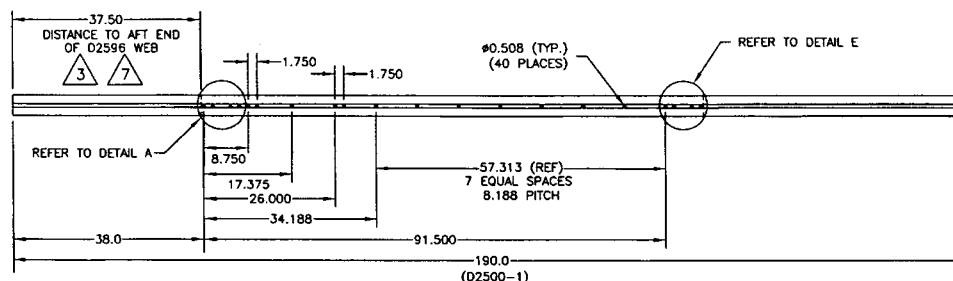

D2580-5 BENDING AND CUTTING DETAIL
(MAKE FROM D2580-1 DRILLING DETAIL)

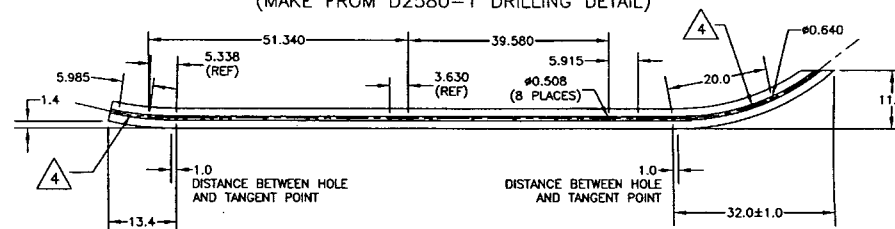

D2580-045 ASSEMBLY DETAIL

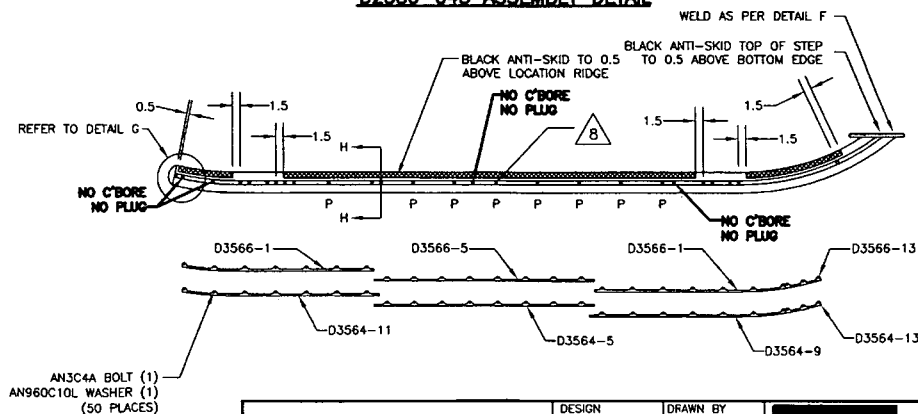

D2580-045 NOTES

- 1) FINISH: ACID ETCH, ALODINE PER DART QSI 005 4.1 PRIOR TO INSERTING D2596 WEB. POWDER COAT ENTIRE ASSEMBLY GREEN (REF. 4.3.5.8) PER DART QSI 005 4.3. BLACK ANTI-SKID PAINT AS INDICATED PER DART QSI 005 4.4.
- 2) IT IS ACCEPTABLE TO GRIND A RELIEF IN THE D2855 AFT CAP TO PREVENT INTERFERENCE WITH THE SPACER AT THIS LOCATION.

COPYRIGHT © 1986 BY DART AEROSPACE LTD.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

DESIGN RH	DRAWN BY RH	DART	DART AEROSPACE LTD. HAWKESBURY, ONTARIO, CANADA
CHECKED H	APPROVED H	DRAWING NO. D2580	REV. 0
DATE 07.02.27	TITLE 205 SKIDTUBE ASSEMBLY	SHEET 3 OF 3	SCALE 1:24